










Status	LED Indicator
Pairing mode	LED flashes fast blue and red
Connected 1 device	LED stays blue/white/yellow/green
Connected 2 device	TX mode: LED stays purple/blue/cyan/ yellow/green
	RX mode: LED stays purple
Disconnected	LED flashes blue once every 3 seconds
Reset	Hold @ button for about 7 seconds, LED flashes purple for 3 times.



中折线



Note: In RX mode, if there is a sound delay, please double-click button to improve the sound quality.

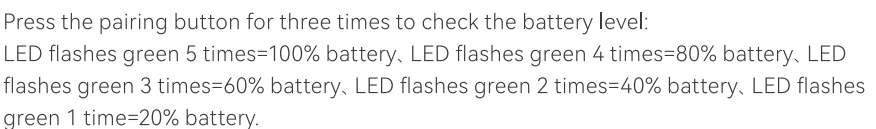


FCC

This device complies with part 15 of the FCC Rules. Operation is subject to the condition that this device does not cause harmful interference (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.Changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

CE
ANKBIT international hereby declares that this product is in compliance with the essential requirements and other relevant provisions of Directive 3014/53/EU.

In accordance with Article 10(2) and Article 10(10), this product is allowed to be used in a EU member states.



Qualcomm aptX is a product of Qualcomm Technologies, Inc. and/or its subsidiaries.

NOTE:

1.If you paired your headphones with a different Bluetooth device, turn Bluetooth OFF on said device(s). AirPods in particular will always prioritize Apple devices for automatic pairing, so you'll need to turn your iPhone's Bluetooth OFF when pairing your AirPods with the ML300.

2.If you're not getting audio while dual linked, try turning the affected headphones off and then on again. In some cases, dual pairing with AirPods may trigger their audio MUTE function. If this happens, put them back in their charging case (with the lid open) for 2 seconds, then take them out again to return them to normal. This may help to solve the problem.

Warranty
Warranty service is limited to normal use. Any man-made damages such as from connecting to an unsuitable power source, using an unsuitable device, or not following the instructions, as well as damages that did not occur during shipping, repairs, and adjustments not approved by the company, damages from misuse, inattention, or improper installation may cause the warranty to be ineffective immediately. This warranty does not include shipping fees.

We simply act as EU representative for cross-border sellers, and are not manufacturers/importers/distributors for the product, nor involved in the manufacture/import/sale of the product. Therefore, we are not responsible for any after-sales services related to the product. In case of any product quality or infringement issues, the manufacturer/importer/seller shall be solely held responsible

Operator: Ankbit International Limited
Address: 45-51 Chatham Road South, Tsim Sha Tsui, Kowloon, Hong Kong
Manufacturer: ShenZhen Ankbit Electronics Limited
Address: Runfeng Industrial Park, No. 4197 Baoan Blvd., Xixiang St., Baoan Dist.,
Shenzhen, China

FCC ID: 2AUFR-RT239 IC: 29252-B03 HVIN: ML300



说明书四色印刷105g铜板纸
说明书**先琴叶折再上下对折**尺寸: 124X95mm

项目名称	RT239	备注	
物料名称	RT239 说明书(中性)	版本	VER:6.2
物料编号	07.69R239032	制作	Winson
物料尺寸	124*95mm	日期	2025/06/17